





WARNING Please refer to the Safety Precautions on pages 4-7 for more detail to prevent injury or death regarding the operation and service troubleshooting of the Multi V product.

Error No.	Description	Details	Causes
242	Network error.	Network error of central controller.	1. RS-485 communication wiring defect. 2. Communication defect between remote controller and indoor unit. 3. RS-485 DIP switch setting error 4. Indoor unit addressing setting error on central controller

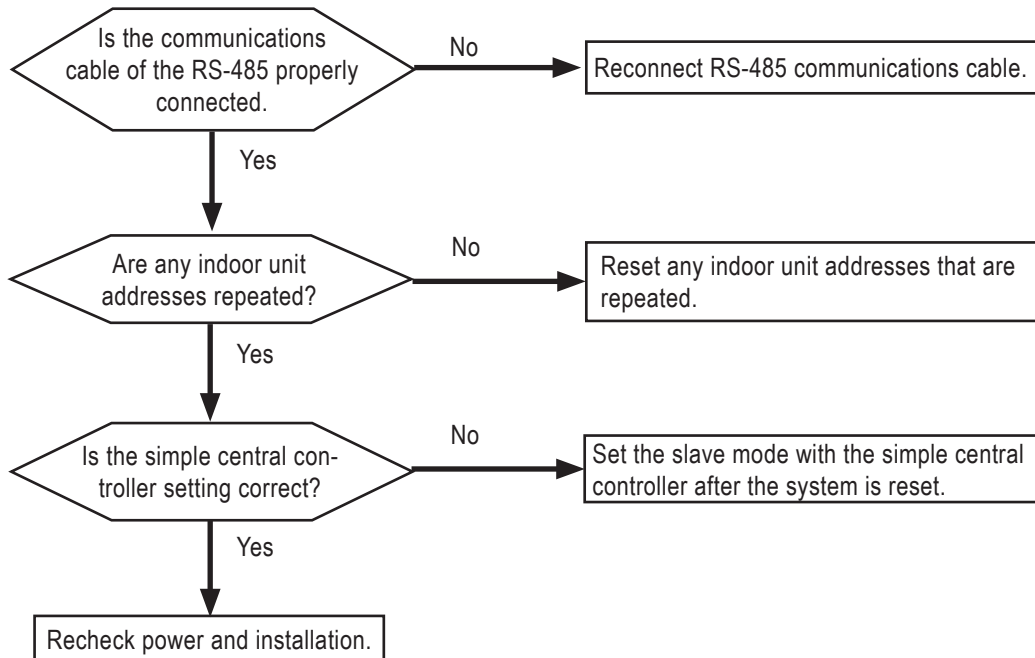

Incorrect RS-485 Communication Wiring

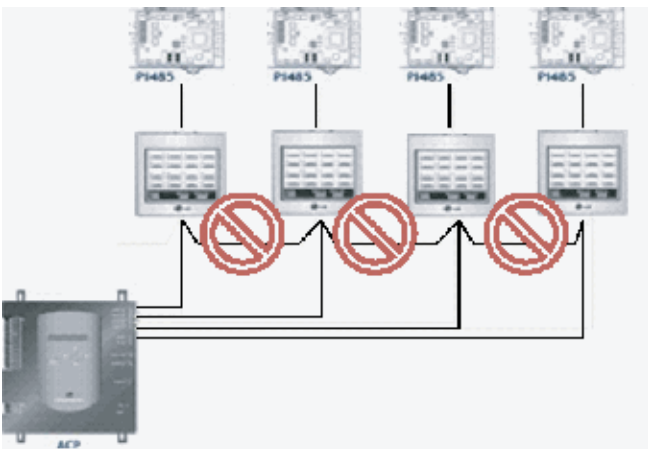

Communications LED Between the Network and the Outdoor Unit
(The communications LED flashes on and off when communication is normal between the network and the outdoor unit.)



Note:

Images here are representative of system components. Actual component appearance depends on model and system type.